

# Inspection Sample Report

**Furniture** 

Thank you for your interest in our inspection sample report!

Contact us for any enquiries www.eurofins.com/assurance/consumer-products/



O	Office		AQM	Vietnar	n				Cı	ıstome	er				
	rt number		514		141					Brand					
	ction type ction date	- 1	FI1	FIN	NAL		Ар	ent							
	ection city							plier							
	spector						Fact								
	7/10	•			Orde	r number		Reference	e / Model	1	(	Color		Des	cription
							-				٨	Natural			ENTRO ROBI ADRADA
/4					Ordered quar		uantity Packed quantity   %				Presented quantity   %			Cartons quantity	
			Orayeous ivide		:	1512		1400		93%	15	12	100%	1	1400
			Purchase Order	Packing	list Con	formity sam	ple Tec	hnical file	Labtes	t	Inspe	ction level			III
nspecti	on performed wit	th –	NO	YES		YES		YES	NO			ty inspected			200
										Ove	erall re	sult		Rev	
			1.Workmans	hip	2.0	Conformi	ty	3.Produ	ct Measu	ıremei	nt 4.0	On-site Tes	it	5.P	acking
	assed		Х			Х			Х			Х			
	ailed														
Kese	ervations														X
					Level		Cri	tical defe	cts		Major det 2.5	ects		Minor o	
					Allowance		accepte		efused	acc	epted	refused	ac	cepted	refuse
լ.	^	\QL					0 1			10 11			14	15	
		יענ	•	N	° of defect	:S		0			Galar line	(2)		Dlask d	
				Nature o	of most im	portant					Color line Black mar		-	Black d Dirty	
				defects							DidCK IIIdi	K (±)		Dirty	(±)
2.	Con	form	ity	Pass						OK					
					1										
3.	Dimensio	ns &	Weight	Pa	ass		ОК								
<b>'</b> .	Difficition	713 OL	.veigiit	1.0	,,,,										
1.	On-s	site T	est	Pa	ass		OK								
5.	Pa	ncking	g	R	ev			No ca	arton lal	bel wa	as provide	ed for che	ecking	g	
									-					-	
							Ann	roved sam	nple was	provid	ed by the f	actorv			
											d by the fa				
	General con	nmer	nts	Shi	pment qua	ntity is 1						tead of 1,9	900pcs	5 (	)
											e by the Cli the actual				
				5:		6:								D l. l	
	Sealed b	oag		Size	Color	Qty	Probl	ems (Dx, Cx	, IVIX)	Size	Color	Qty		Problems (E	ox, Cx, Mx)
	Jealed I	- 46			<del> </del>					1					
					L					l					



# 1.Workmanship

Ref		Item	MESA CEN	TRO ROBLE CUADRA	ADA	Customer		
MAJOR DEF	FECT DESCRIPTION	Size of defect (cm)	Major			Color / Model	Serial #	Defect number
	Color line Black mark	N/A 3	2			Natural-052 Natural-052	N/A N/A	D1 D2
MINOR DEF	ECT DESCRIPTION	Size of defect (cm)		Minor		Color / Model	Serial #	Defect number
	Black dot Dirty	0.3		2		Natural-052 Natural-052	N/A N/A	D3 D4
			L					
CRITICAL DE	FECT DESCRIPTION	Size of defect (cm)			Critical	Color / Model	Serial #	Defect number
			ļ	ļl				ļ



## 2.Conformity

	Ref	Item	MESA CENTRO ROBLE (	CUADRADA <b>Customer</b>
	Points to check	Pass / Fail	Sample Size	Comments
2.1	Product style checking	Pass	200	ОК
2.2	Conformity with sample-tech file	Pass	200	ОК
2.3	Conformity and position of stickers	N/A		N/A
2.4	Conformity and position of logo	Pass	200	ОК
2.5	Conformity of recycle logo	Pass	200	OK
2.6	Conformity of technical tag	Pass	200	ОК
2.7	Conformity of barcode on item	Pass	200	ОК
2.8	Conformity of serial number	Pass	200	ОК
2.9	Conformity of product packaging	Pass	200	ОК
2.10	Conformity of special instructions	N/A		N/A
2.11	Conformity of print	Pass	200	ОК
2.12	Conformity of color (pantone)	Pass	200	ОК
2.13	Conformity of raw material	Pass	200	ОК



# 3.Dimensions & Weight

Model / Reference				Color						c	Custom	er				
				Sample Number												
Check Point	Tol	Theor. Meas	M1	M2	M3	M4	M5	M6	M7	M8	M9	M10	M11	M12	M13	M14
Product Length (cm)	N/A	70.0	70.0	70.0	70.0	i i i i			1 1 1 1	1 1 1 1				 		
Product Width (cm)	N/A	60.0	60.0	60.0	60.0	1 1 1 1 1 1	1			 				 		
Product height	N/A	46.0	46.0	46.0	46.0	†				†				†		
Porduct Weight w/oPackage (kg)	N/A	N/A	7.0	7.0	7.0	†	[			†				†		
(kg) Porduct Weight with Package (kg)	N/A	N/A	8.0	8.0	8.0	 										
						†				†		! !		† ! ! ! !		
						†				 				 		
									         	i       		†				
									   		} !	<del> </del>				
												ļ				ļ
				i 	 	i 	i 		i   	i 	ļ 	ļ 	 	i 		ļ
						 			   	†				†		
								L		 	ļ	ļ		 		ļ
			 	 	 	 	 	 	   	 	<u> </u> 	<u> </u>	<u> </u> 	 		ļ
			ļ	i		i				i   		ļ		ļ		ļ
				 	 	i  !	i 		 	i 	ļ 	ļ		 		ļ
			ļ	 		†				i I I		ļ		i I I		ļ



#### 4.On-site Test

	Ref	Item Description	MESA CENTRO ROBLE	CUADRADA Customer	
	Points to check	Pass / Fail	Sample Size	Comme	nts
4.1	Carton drop test	Pass	1	ОК	
4.2	Carton humidity test	Pass	1	ОК	
4.3	Wood humidity test	Pass	1	ОК	
4.4	Product solidity test	Pass	8	ОК	
4.5	Stability test	Pass	8	ОК	
4.6	Wobbling test	Pass	3	OK	
4.7	Assembling test	Pass	8	ОК	
4.8	Loading test	Pass	8	ОК	
4.9	Product color resistance test (rubbing test with a dry tissue)	Pass	8	ОК	
4.10	Print resistance test	Pass	8	OK	
4.11	Smell test	Pass	20	ОК	
4.12	Barcode scanner	Pass	8	ОК	



#### 4.Barcode scan

Ref		_		MESA CENTRO ROBLE CUADRADA	Customer		
em number	Description	Barcode number on document or sample	Visual Ch	eck Scan	Check	Result	
	Export Carton	N/A	N/A	N	I/A	N/A	
	Gift box	N/A	N/A	N	I/A	N/A	
	Product					Pass	
		*					
		*					
		¥					
		·					
		·					






	Ref	Item Description	MESA CENTRO ROBLE	CUADRADA Customer
	Points to check	Pass / Fail	Sample Size	Comments
5.1	Cartons general checking	Pass	200	ОК
5.2	Cartons shipping marks	Rev	200	P2: Missing carton label (100%)
5.3	Carton closure way + Tape used ( Transparent, opaque)	Pass	200	ОК
5.4	Size of cartons	Pass	200	74x64x7cm
5.5	Weight of cartons	Pass	200	8.5kgs
5.6	Carton opening way	Pass	200	ОК
5.7	Carton thickness _ Number of Ply	Pass	200	5 ply
5.8	Logistic control _ Quantity per carton	Rev	200	P1: Shipment quantity is 1,512pcs ( ) instead of 1,900pcs ( )
5.9	Assortment and or Homogeneous cartons quantity	Pass	200	ОК



#### **Packing list**

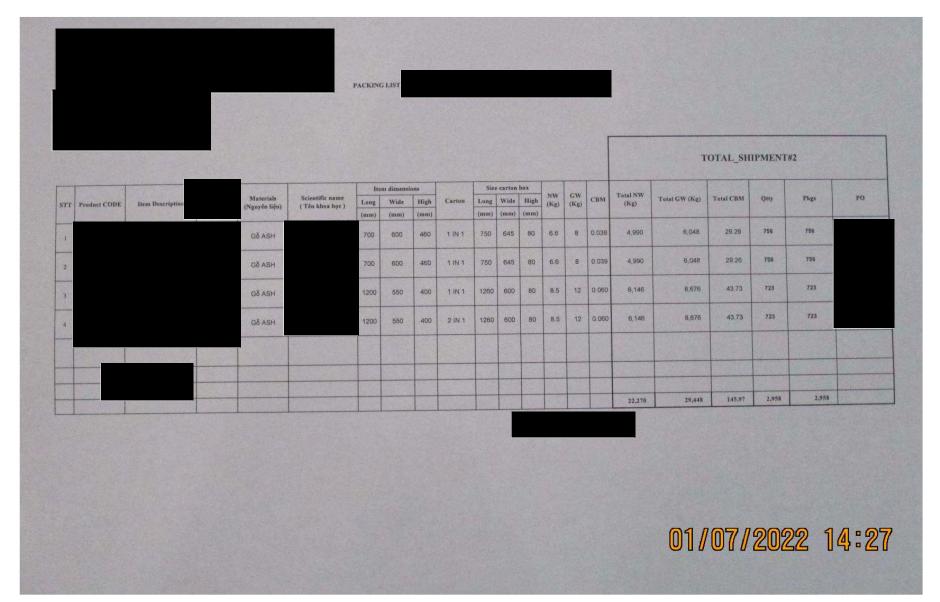

## **6.Picking List**

Overall condition

Customer					
Brand name					
Order number					
Reference / Model code	_				
Reference / Model name					
Item description					
Product category					
Season					
Ordered quantity	1512				
Total packed qty	1400				
Total presented qty	1512				
Qty of presented cartons	1400				

Report n°						
Inspection type	FI1					
Level	III					
Inspection date						
Inspection place	On-site					
Province						
City						
Agent						
Supplier						
Factory						
If Reinsp number of previous report						
Inspector						

Factory GPS Coordinates		١,	
	200		
Inspected products	200		

Factory Manpower/Packer

	NAME	CODE
Color1	Natural	
Color2		
Color3		
Color4		
Color5		
Color6		

Brightness

Inspection cond	litions	Not available		Clean	Sufficient		Good
Order number	Reference number	Color	Carton number	Serial #	Qty of pdts in carton	Qty of pdts picke	ed Final qty of pdts in ctn
		Natural -052	No carton number	N/A	1	200	N/A

Cleanliness



0 Product Picture 1



1 - D1-Color line 1



0 Product Picture 2



1 - D1-Color line 2





1 - D1-Color line 3



1 - D2-Black mark 1



1 - D1-Color line 4



1 - D2-Black mark 2





1 - D3-Black dot 1



1 - D3-Black dot 3



1 - D3-Black dot 2



1 - D3-Black dot 4





1 - D4-Dirty mark 1



2.1 Product style checking 1



1 - D4-Dirty mark 2



2.1 Product style checking 2





2.1 Product style checking 3



2.1 Product style checking 5



2.1 Product style checking 4




2.2 Conformity with sample-tech file 1





2.2 Conformity with sample-tech file 2

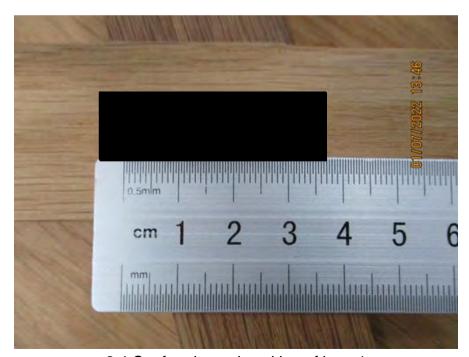

2.4 Conformity and position of logo 1



2.2 Conformity with sample-tech file 3




2.6 Conformity of technical tag 1






2.6 Conformity of technical tag 2

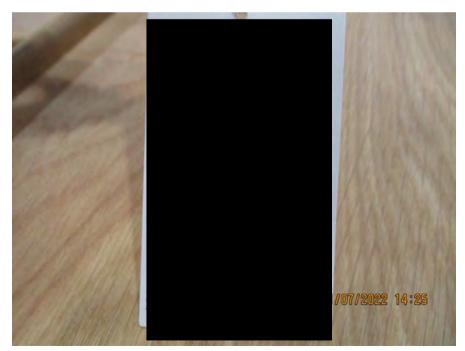

2.7 Conformity of barcode on item 2



2.7 Conformity of barcode on item 1

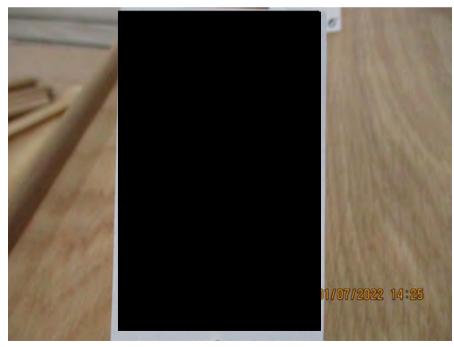

2.7 Conformity of barcode on item 3






2.7 Conformity of barcode on item 4



2.12 Conformity of color (pantone) 1

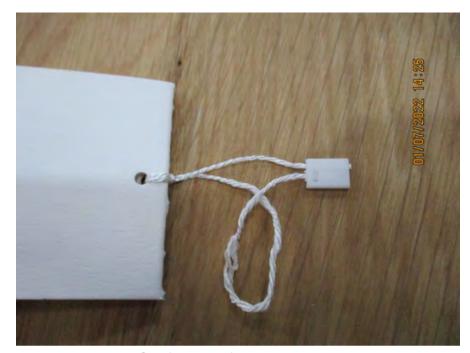

2.7 Conformity of barcode on item 5



2.12 Conformity of color (pantone) 2





2.12 Conformity of color (pantone) 3



2.12 Conformity of color (pantone) 5



2.12 Conformity of color (pantone) 4



2.12 Conformity of color (pantone) 6





2.12 Conformity of color (pantone) 7



3 - Product dimension 2



3 - Product dimension 1




3 - Product dimension 3





3 - Product dimension 4

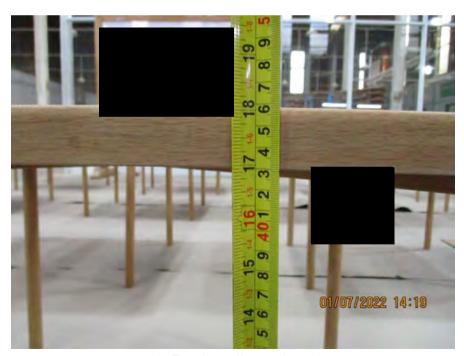

3 - Product dimension 6



3 - Product dimension 5



3 - Product weight 1





3 - Product weight 2



4.1 Carton drop test 2



4.1 Carton drop test 1



4.1 Carton drop test 3





4.2 Carton humidity test 1



4.6 Wobbling test 1



4.3 Wood humidity test 1



4.7 Assembling test 1





4.7 Assembling test 2



4.9 Product color resistance test (rubbing test with a dry tissue) 1




4.8 Loading test 1



4.9 Product color resistance test (rubbing test with a dry tissue) 2



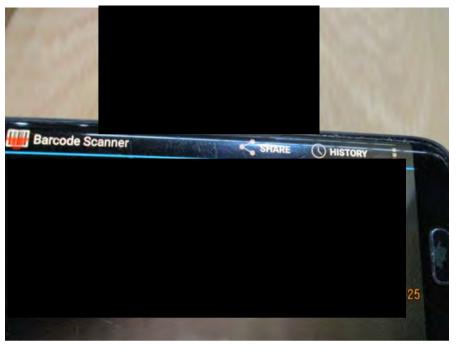


4.12 Barcode scanner 1



5.1 Cartons general checking 2




5.1 Cartons general checking 1

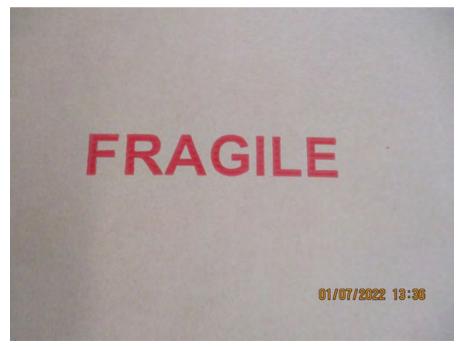

5.2 Cartons shipping marks 1




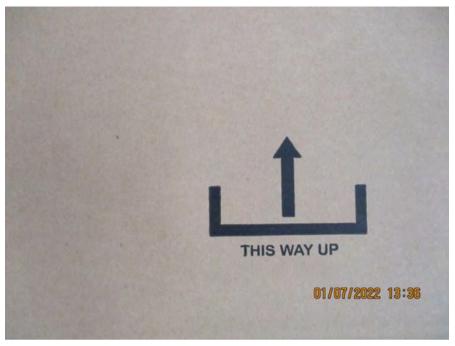

5.2 Cartons shipping marks 2



5.4 Size of cartons 1

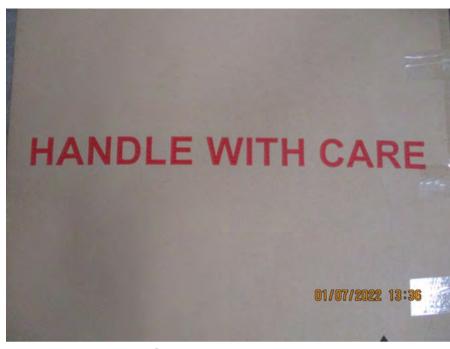

5.2 Cartons shipping marks 3



5.4 Size of cartons 2





5.4 Size of cartons 3



5.4 Size of cartons 5



5.4 Size of cartons 4



5.4 Size of cartons 6






5.5 Weight of cartons 1



5.6 Carton opening way 1



5.5 Weight of cartons 2

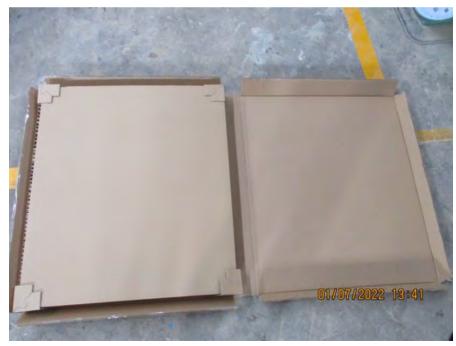

5.6 Carton opening way 2





5.6 Carton opening way 3



5.7 Carton thickness \_ Number of Ply 1




5.6 Carton opening way 4



5.8 Logistic control \_ Quantity per carton 1



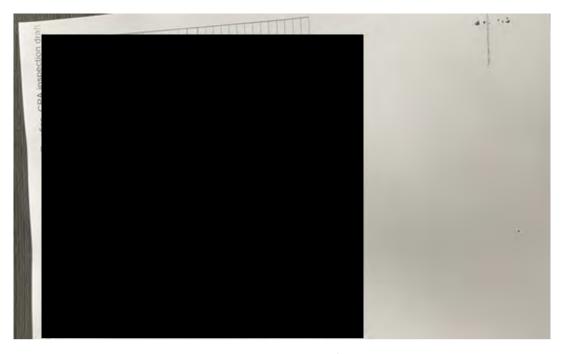


6.6 Inspection draft 1



7.3 Factory name and address 1



6.6 Inspection draft 2

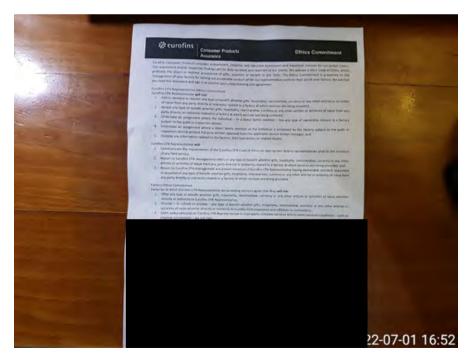

7.4 Ethics commitment 1

